
## FAN AND GENERATOR V BELT (1ZZ-FE) REPLACEMENT

1400D-02

## 1. REMOVE ENGINE UNDER COVER RH

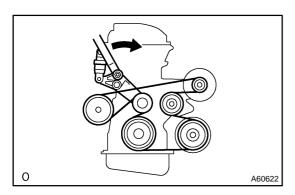

2003 COROLLA MATRIX

218W (RM940U)

## 2. REMOVE FAN AND GENERATOR V BELT

(a) Turn the V-ribbed belt tensioner slowly clockwise and loosen it. Then, remove the fan and generator V belt and put back the V-ribbed belt tensioner little by little and fix it quietly.

Author: Date:

1269